

Окончание таблицы

Проходы условные D ₄ x D ₁ x D ₂ x D ₃	d	d ₁	d ₂	d ₃	D ₁	D ₂	D ₃	S	S ₁	S ₂	S ₃	L	L ₁	L ₂	L	L ₁	L ₂	L ₃	H ₁	H ₂	B	B ₁	C	C ₁	масса кг
25x25x40x32		35		30		45	38				4	90	53		58		18,5	18,5	24	42	48	5	II		0,824
25x25x40x40	24	40		35	34	45	45	5			5	95	56	32	74					48	58	-			0,883
25x25x50x40			40	46		56	56				5	105	63	34	86		18,0	18,0	27	58	58	II	Ib		1,200
25x25x50x50				46								120	63	34	86		29,0	29,0	56			-			1,360
25x32x40x25			26			34	34				4	85	50		62		18,0	18,0		36	36	II	II		0,774
25x32x40x32	30	35	20	35	38	45	30	5			4	90	53		66		18,5	18,5	50	42	48	5	II		0,600
25x32x40x40				35			45					95	56	32	74				105	48	48	-			0,866
25x40x50x25			24			34	34				5	85	50		62		18,0	18,0		36	36	Ib			0,883
25x40x50x40	35	45	35	40	45	56	45	5			5	95	56		74		18,0	18,0	50	27	48	II	Ib		1,060
25x40x50x50				40			56					110	63	34	86		29,0	29,0	120	58	58	-			1,230
32x32x40x40			35	35		45	45					90	54	30	72		24	24	110		48	48	5		0,910
32x32x50x32	30		30	35	38		38	4			4	95	56	33	69		21,0	21,0		29	42	14			1,080
32x32x50x40				35			45				5	100	56	32	74		23,5	23,5	58	58	58	II	I4		1,150
32x32x50x50				40	38		56	4				110	62	33	85		29,0	29,0	120		58	-			1,200
32x40x50x32			40	30		56	36				4	95	56	35	71		21,0	21,0		42	42	14			1,050
32x40x50x40				35	45		45	5			5	105	56	32	74		23,5	23,5		50	31	58	II	I4	1,100
32x40x50x50	35			45			56					110	63	34	86		29,0	29,0			58	-			1,250
40x40x60x60			45	45		56	56	5				110	63	34	86		33,5	33,5	125	33	33	-			1,340

Таблица 13


Проклады условные ДхВххЛхЗ	d	d ₁	d ₂	D	D ₁	D ₂	S	S ₁	S ₂	L	L ₁	L ₂	L ₃	L ₄	H	H ₁	H ₂	H ₃	B	B ₁	C	масса, кг	
																						б	в
6x 6x15	6	6	14	10	10	20	2	2	3	60	19	7,0	7,0	11	53	28	22	31,0	31,0	12	22	6	0,061
10x10x15	10	10	17	16	16	25	2	3	4	67	22	9,0	9,0	14	63	32	23	37,0	37,0	18	28	4	0,134
10x10x20										71													
10x10x25	10	10	24	16	34	38	3	5	80	90	22	10,5	10,5	18	67	36	27	41,0	41,0	18	28	6	0,179
10x10x32																							
10x15x20	10	14	17	16	25	34	3	4	75	90	24	12,5	12,5	21	71	40	31	45,0	45,0	42	12	0,343	
10x15x25																							75
10x15x32	10	14	30	16	36	34	3	5	85	90	24	13,0	13,0	18	71	38	27	45,0	45,0	22	36	10	0,303
10x20x25																							
10x20x32	10	17	24	16	36	34	3	4	90	90	24	14,5	14,5	21	75	40	29	47,0	47,0	42	12	0,372	
10x25x32																							90
15x15x20	14	14	17	20	25	34	5	4	100	75	29	12,5	12,5	21	90	48	30	60,0	60,0	36	42	6	0,635
15x15x25																							
15x15x32	14	14	24	20	34	38	3	5	85	90	24	13,0	13,0	18	75	40	29	47,0	47,0	22	28	4	0,220
15x15x40																							
15x15x50	14	14	35	20	45	50	3	5	95	105	24	13,5	13,5	24	80	45	34	52,0	52,0	48	13	0,472	
15x15x50																							105

Окончание таблицы 13

Проходы условные <i>Ду x Двн x Двз</i>	<i>d</i>	<i>d1</i>	<i>d2</i>	<i>D</i>	<i>D1</i>	<i>D2</i>	<i>S</i>	<i>S1</i>	<i>S2</i>	<i>L</i>	<i>L1</i>	<i>L2</i>	<i>L3</i>	<i>H</i>	<i>H1</i>	<i>H2</i>	<i>H3</i>	<i>B</i>	<i>B1</i>	<i>C</i>	Масса, кг
15x20x25			24			34		5	85		13,0	18		60	42	28	50,5	36	6	0,392	
15x20x32		17	30	25		38		4	90		13,0	21		60	42	28	50,5	42	12	0,450	
15x20x40			35			45	3	5	95	24	13,5	24		65	45	31	53,5	48	13	0,500	
15x20x50	14		46	20		56			105		14,5	29		65	34	56,5	50,5	56	16	0,711	
15x25x32			30			38		4	100	29	13,0	21		90	30	60,0	60,0	42	6	0,639	
15x25x40		24	35	34		45			105		13,5	24		90	50	62,0	62,0	36	11	0,733	
15x25x50			46			56		5	120	31	13,0	29		95	53	65,0	65,0		16	0,909	
20x40x50		35	46	45					100	29	14,5	21		105	58	75,5	75,5	48	11	1,140	
20x25x32			30			38		4	100	29	14,5	21		90	48	30	60,0		12	0,639	
20x25x40		24	35	34		45			105	31	15,0	24		90	48	30	60,0	36	11	0,770	
20x25x50	17		46	25		56	4	5	120	31	14,5	29		95	53	65,0	65,0		16	0,920	
20x40x50		35	46	45					125	29	14,5	29		105	58	75,5	75,5	48	11	1,190	
25x32x40		30	35	38		45	5	4	105	29	18,5	24		100	53	68,0	68,0	42	48	5	0,662
25x40x50	24	35	46	34		56		5	125	34	18,0	29		110	58	75,5	75,5	48	56	11	1,230

СГ 95 53 13

3.16 Переходник конусный. Исполнение 2

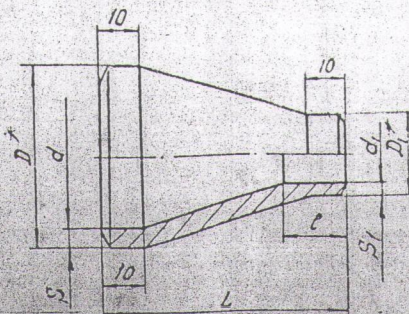

*Размеры для справок
Рисунок 10

Таблица 10

Размеры в миллиметрах

Размеры основные D ₂ x D ₁ /l	d	d ₁	D	D ₁	s	s ₁	L	l	Масса, кг
10x5	10	6	16	10	3	2	40	10	0,027
15x10	14		20						0,055
20x10	17		25		4			17	0,078
25x10	24	10	34	16	5				0,118
32x10	30		38		4			15	0,136
40x10	35		45		5		50		0,154
50x10	46		56		5			13	0,186
30x15	17		25		4	3		22	0,086
25x15	24		34		5			18	0,126
32x15	30	14	38	20	4			16	0,146
40x15	35		45				60		0,194
50x15	46		56		5		75	15	0,290
65x15	66		76				85		0,44
25x20	24	17	34	25		4		17	0,145
32x20			38		4		50	18	0,171
32x25	30	24	38	34	4	5		10	0,197
40x20		17		25		4		14	0,216
40x25	35	24	45	34	5	5	60		0,254
40x32		30		38		4		10	0,27

Дополнение таблицы I6

ОСТ 95 53-98

Размеры в миллиметрах

Номер п/п	Номинальные размеры	d	d_1	D	D_1	S	S_1	L	l	Масса, кг	
50	50x20	45	17	56	25	5	4	75	13	0,319	
50	50x25		24		34		5				
50	50x32		30		38		4		10	0,368	
50	50x40		35		45		5				0,396
65	65x20	65	17	76	5	5	85	12	0,419		
65	65x25		24							34	4
65	65x32		30					38	5	0,521	
65	65x40		35					45	4		0,553
	65x50	46	56	5	0,579						
	80x25	77	24	89	5	5	100	13	0,636		
	80x32		30							38	4
	80x40		35					45	14	0,849	
	80x50		46					56			5
	80x65	66	76	5	0,966						
	100x40	95	35	108	6	6	100	22	1,100		
	100x50		46							56	13
	100x65		66					76	15	1,100	
	100x80		77					89			10
	125x40	121	35	133	6	6	120	10	1,360		
	125x50		46							56	12
	125x65		66					76	13	1,500	
	125x80		77					89			14
	125x100	95	108	6	10	1,850					
	150x50	143	46	159	6	6	120	16	2,020		
	150x65		66							76	15
	150x80		77					89	17	2,500	
	150x100		95					108			16
	150x125	121	133	6	18	2,890					
								26	3,140		